



1. EXISTING STONE WALL IS APPROX. 40 FEET LONG AND HAS A TYPICAL WIDTH OF APPROX. 1.5 FEET WIDE, WITH A TYPICAL HEIGHT RANGING FROM 7.5 FEET HIGH TO 3 FEET HIGH ABOVE GRADE.

2. APPROX. 25% OF THE WALL (FRONT ONLY) NEEDS REPAIR WHICH INCLUDES BUT IS NOT LIMITED TO TUCKPOINTING LOOSE AND/OR CRACKED MORTAR JOINTS, RESETTING OR REPLACING LOOSE OR MISSING/BROKEN

3. CLEAN AND REUSE EXISTING STONES AS MUCH AS POSSIBLE. PROVIDE NEW MATCHING STONES AS NEEDED TO FULLY COMPLETE THE WALL REPAIR WORK BACK TO ORIGINAL CONDITION MATCHING ADJACENT UNDISTURBED

4. ALL NEW MORTAR FOR THIS WALL PROJECT SHALL HAVE THE COLOR MATCH WITH THE EXISTING AGED MORTAR AS CLOSELY AS POSSIBLE.

5. COMPLETE AN INITIAL TEST SECTION OF WALL TUCKPOINTING AND OBTAIN COR APPROVAL FOR COLOR AND WORKMANSHIP PRIOR TO PROCEEDING WITH THE ENTIRE PROJECT.

6. SURFACE FINISH TOOLING PATTERN OF ALL RETUCK POINTED JOINTS TO MATCH EXISTING SURFACE FINISH TOOLING PATTERN OF THE ADJACENT EXISTING AREAS OF THE MONUMENT STONE WALL. COMPLETED WORK TO VISUALLY MATCH AND BLEND WITH SURROUNDING MONUMENT STONE WALL IN COLOR AND TEXTURE AND PATTERN.

NOTES:





PROJECT AREA - ADMIN WALL









EXAMPLE OF BROKEN & LOOSE STONES; CRACKED & LOOSE MORTAR JOINTS



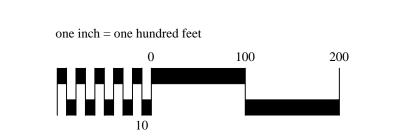

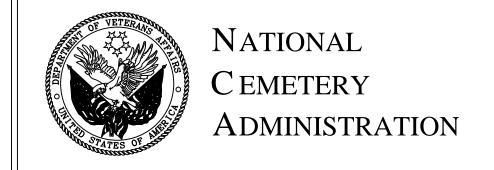

SITE PLAN - ADMIN BLDG STONE WALL	Project Title REPAIR PAVEMENT, STONE	Date 6/16/201
	WALLS & WALKWAY	Project No. 774CM3915
Approved: Division Chief	Building Number Checked Drawn	DRAWING

Approved: Service Director

774CM3915-002 ||Building Number ||Checked ||Drawn DRAWING NO. RNE Location FORT CUSTER NATIONAL CEMETERY

6/16/2015